

Mounting NoTap adapter for immersion pipes

139070E

Adapter for immersion pipes designed for pipe sizes from DN20 to DN100 For NoTap type S1 clamp with non-return valve

The adapter is made of surface-treated brass. Two seals are supplied for use when mounting the adapter. The size of seal appropriate to the immersion pipe diameter should be selected.

The immersion pipe diameter should be 10-12 mm.

An immersion pipe with a length of 63 mm may be used for all pipe sizes.

An immersion pipe with a length of 100 mm may be used for pipe sizes from DN 65 up to DN100.


The internal adapter thread for connection to the immersion pipe is DN 15.

Mount a type S1 clamp with a non-return valve on the pipe as in instruction "Fitting NoTap clamps" and drill a hole in the pipe.

Fit the seal for the appropriate size of the immersion pipe in the bottom of the adapter and screw the adapter onto the clamp. The seal supplied is designed for permanent sealing between the clamp and adapter. Apply sealing to the thread between the immersion pipe and adapter. Insert the immersion pipe through the adapter and screw tight.

Note: Some resistance will be felt when inserting the immersion pipe into a pipe under high pressure since the pressure will tend to force the pocket out.

Mounting is now complete.

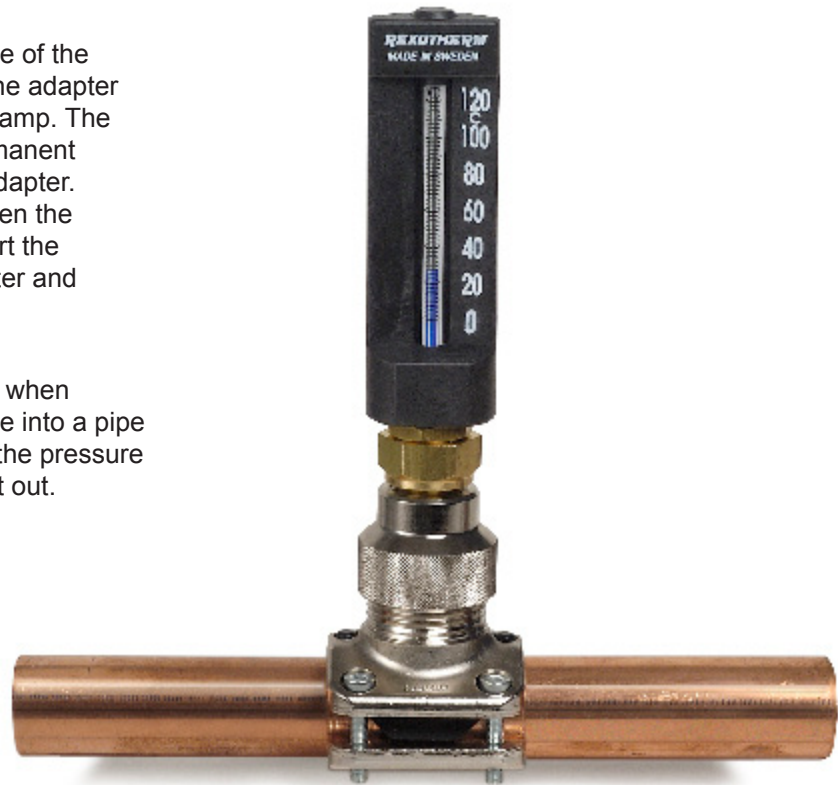

Rev. 150623 dim

Warning!

Although the non-return valve in the clamp is designed primarily for holding initial pipework, it will retain its function for a longer period. Nevertheless, caution must be used if and when a clamp is replaced.